


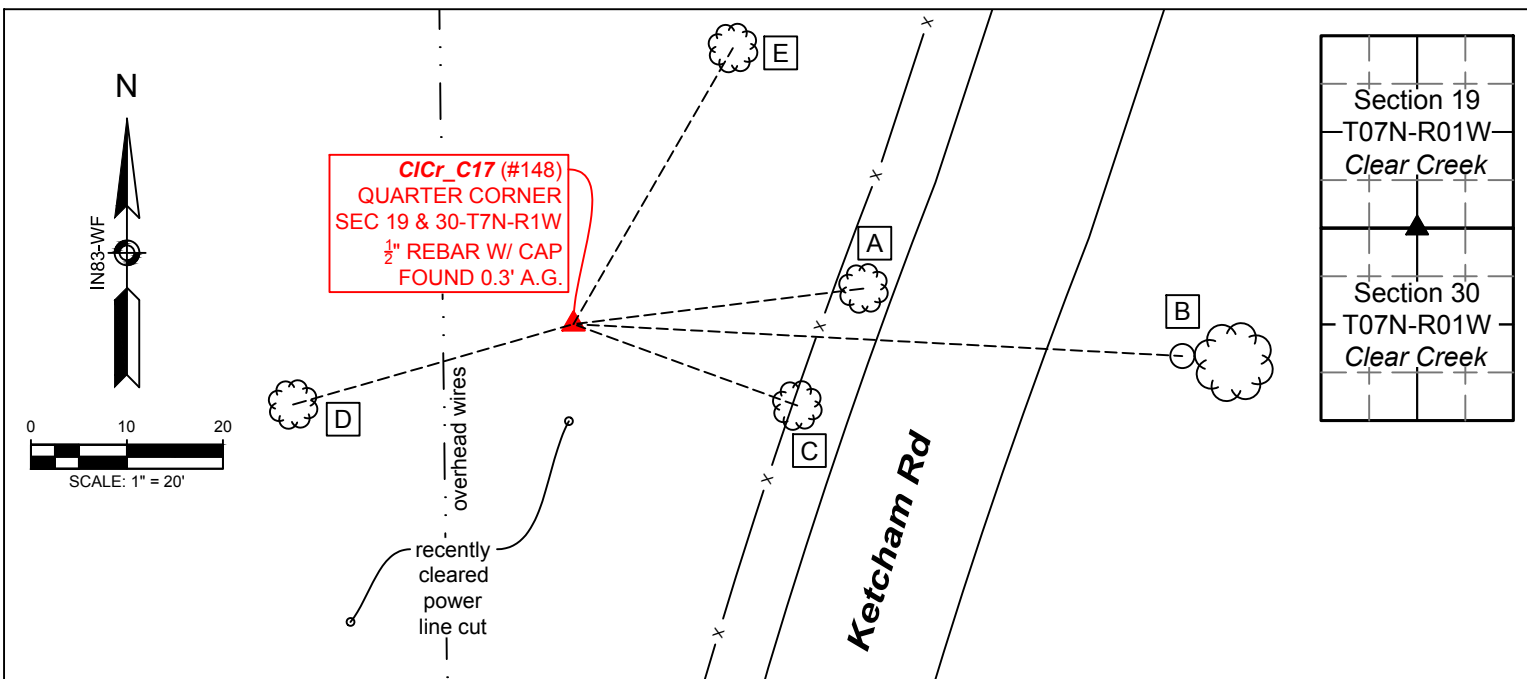

OTHER ACCESSORIES:

A 5-foot steel t-post was set on the west side of the rebar 2.6 feet above grade. A Monroe County Surveyor Marker sign was attached on the east side of the post, 1.8 feet above grade.

OTHER OBSERVATIONS:


The rebar is ~30' west of the west edge of Ketcham Road, on a gentle north slope, in a recently cleared north/south utility cut.

NOTES:

- Field work was performed on March 16, 2017.
- Monroe County Surveyor's Field Book 50, page 3 and Field Book 51, page 2.
- Project Name: ClearCreek2017, Field work by: RSO, Drawn by: RSO, Reviewed by: RSO & TER.
- Coordinates shown hereon were obtained from GPS observations utilizing the Indiana Real-Time Network (INCORS). Indiana West Zone, NAD83(2011) Epoch 2010.0000, State Plane Grid Coordinates, US Survey Feet. Geoid model G2012BU7. Datum NAD83_NO_TRANS.
- Coordinate data for CICr_C17 was collected using a Topcon Network Rover (PG-A1 antenna and GRS-1 data collector).
- Vicinity sketch was compiled per 2017 aerial photography. Distances to witness ties were collected with a 100' cloth tape. Bearings to witness monument ties were measured with a 2° compass adjusted for declination and are approximately shown hereon for reference. Priority should be given to provided distances over bearings.
- This monument was accepted by the Monroe County Surveyor Review Board on August 21, 2012. We collected coordinates on the known monument in preparation for an upcoming perpetuation survey in the area. Historic research has not yet been performed to prove the validity of this monument. The prior Monument Record references a Steven W. Archer survey performed for Fred Barger, on file in the Office of the Monroe County Surveyor, and an Eric L. Deckard survey performed for Thrasher in 2006, on file in the Office of the Monroe County Recorder in Plat Cabinet S2, envelope 61.

WITNESS MONUMENT TIES:

- Survey sign on 10" white ash; N78°E (to center of tree) 30.4' (to survey sign)
- $\frac{1}{2}$ " iron pipe found 12" above grade, leaning west on the west side of a triple stemmed red oak; S88°E 63.7'
- MAG nail and hack set in old scar in 12" stalk of bifurcated white ash (the other stalk has a 15" diameter and is located closer to the road); S68°E 24.8'
- MAG nail set in hack 0.4' above grade in the south root of a 12" hickory; S74°W 30.4'
- MAG nail and shiner set in hack 1.1' above grade on the east side of a 16" oak; N30°E 33.2'

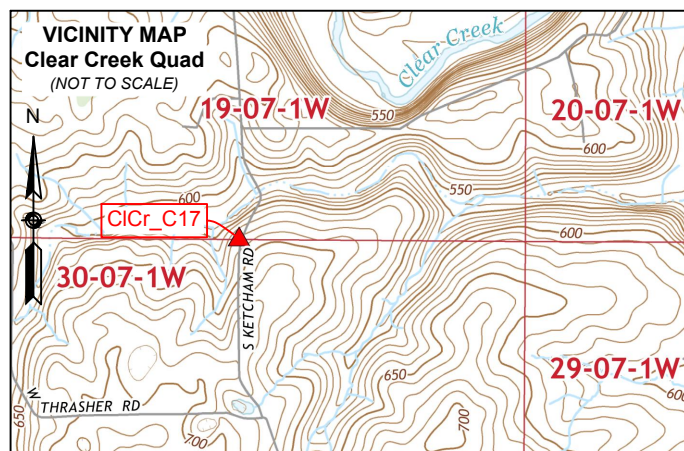


▲ **Monument Description:** $\frac{1}{2}$ " rebar with damaged yellow cap found 0.3' above grade

State Plane Grid Coordinates: Northing: 1374452.0', Easting: 3100523.9'

SHEET 1 OF 2	MONUMENT RECORD CORNER ID: CICr_C17	Quarter Corner Section 19 & 30- T07N-R01W Clear Creek Township Monroe County, Indiana	MONROE COUNTY GOVERNMENT OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	---	---	--


Photos were taken on 3/16/2017 with an iPhone 6s

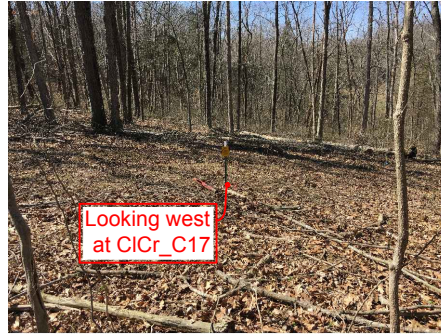

Trohn Enright-Randolph
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review Board
on November 21, 2017

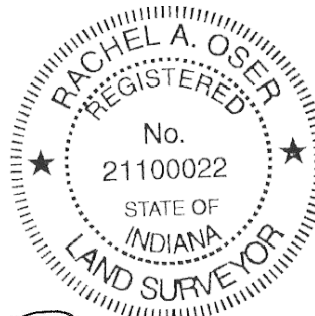

Rachel Oser
Rachel Savich Oser, State of Indiana
Professional Surveyor No. 21100022

SHEET 2 OF 2	MONUMENT RECORD CORNER ID: CI Cr_C17	Quarter Corner Section 19 & 30- T07N-R01W Clear Creek Township Monroe County, Indiana	 MONROE COUNTY SURVEYOR'S OFFICE Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	--	---	---

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 19

Township: 7 North


Range: 1 West

Corner ID: C1 Cr C-17

Monument Description & Remarks: 5/8" Rebar with cap, "ARCHER". Survey Sign 5ft above ground at point B

References On File: Steven W . Archer survey, Fred Barger, on file in Surveyor Office and Eric L Deckard survey, Thrasher (2006), on file in Recorder Office cabinet S2 envelope 61

RECOVERY TIE DRAWING
Field Book 36 Page No. 44

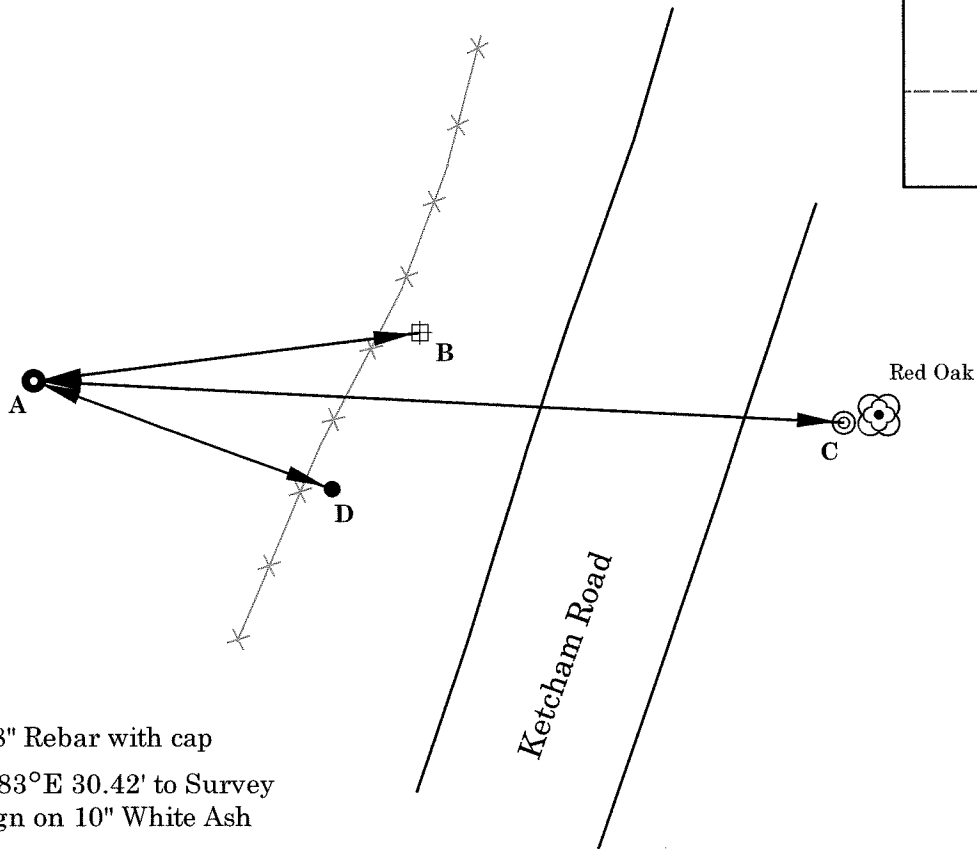

- A - 5/8" Rebar with cap
- B - N 83°E 30.42' to Survey Sign on 10" White Ash
- C - S 87°E 63.50' to 1/2" Iron Pipe 12" above ground
- D - S 70°E 24.80' to MAG nail in 12" White Ash

Not To Scale
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-3-1-1 of the Indiana Code and the above data is given under my hand and seal this 20th day of December, 2005

Kevin P. Enright

Administered by the Monroe County Surveyor Review Board

08-21-2012

